
KFX SIC Integrated Handlebar Installation Instructions

Published –Feb, 2026 ZS229.v2 © Full Speed Ahead

WWW.FULLSPEEDAHEAD.COM

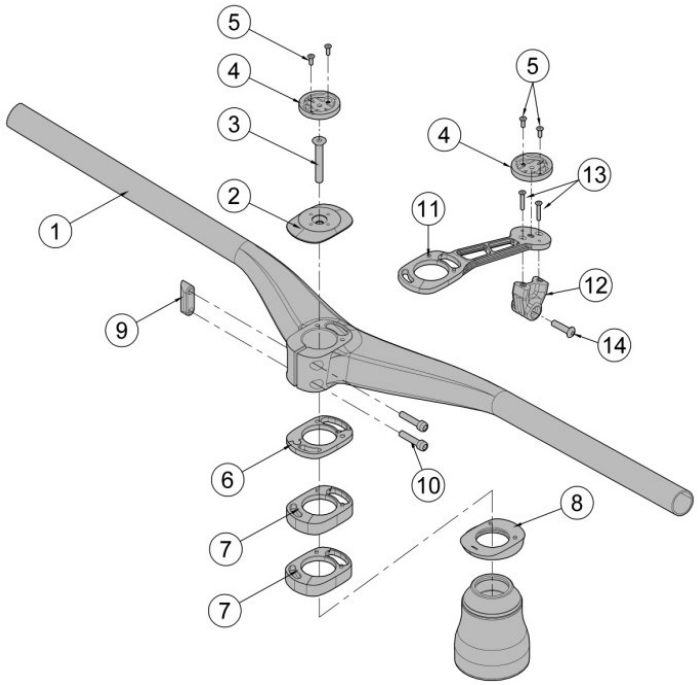

If use standard headtube

Introduction

Congratulations on your Full Speed Ahead product. Please read these instructions and follow them for correct use. Failure to follow the warnings and instructions could result in damage to product not covered under warranty, damage to bicycle; or cause an accident resulting in injury or death. Since specific tools and experience are necessary for proper installation, it is recommended that the product be installed by a qualified bicycle technician. FSA & Vision assumes no responsibility for damages or injury related to improperly installed components.

Warranty

Full Speed Ahead (FSA) warrants all FSA and Vision products to be free from defects in materials or workmanship for a period of two years after original purchase unless otherwise stated in the full warranty policy. The warranty is non-transferable and valid to the original purchaser of the product only. Any attempt to modify the product in any way such as drilling, grinding, and painting will void the warranty. For more information on warranty policy and instructions for completing a warranty claim, check out the Full Warranty Policy found at our website:https://www.fullspeedahead.com/en/support/warranty-policy

Specification

Model Name **KFX SIC Integrated Handlebar**

Components

Follow the assembly order in the illustration :

① Handlebar body
② Stem Top Cap
③ Fixing Bolt M6x35L x1
④ Control Center Base x1
⑤ Control Center Base Screws
M3x8L x2
M3x6L x2 (for installing ⑪)
⑥ 5mm Spacer x1
⑦ 10mm Spacer x2
⑧ Adapter x1
⑨ Nut x1
⑩ Stem Fixing Bolts M5x22L x2
⑪ Light / GoPro Mount x1
⑫ GoPro Adapter x1
⑬ GoPro Adapter screws M3x12L x2
⑭ GoPro screws M5x20L x1

NOTICE Components ⑪ ~ ⑭ includes for different spec accordingly.

Handlebar Installation

1. Cut steerer tube according to manufacturer's instructions. Ensure there are no sharp burrs on the steerer tube. Select correct Spacers ⑥, ⑦ for the desired height of the Handlebar.

CAUTION If using a standard headtube not ICR frame, install the Adapter ⑧ before installing Spacers ⑥, ⑦ for the desired height.

2. It is recommended to apply a light coat of carbon assembly paste (ME068). Slide Handlebar ① fully on to steerer tube.

⚠ WARNING Do not use grease on carbon steerers. Only use carbon assembly paste (ME068).

NOTICE Brake/electronic wiring should be run through the Handlebar before installing Headset.

Cable Installation

1. KFX SIC Handlebar is designed with cable holes allow to cables or hoses to run internally.

⚠ WARNING Never attempt to modify the cable guide holes. Do not drill, saw or file the holes larger or to a different shape. Any modification of the cable guide holes will void the warranty and may lead to premature failure ofthe handlebar, leading to possible loss of control of the bicycle resulting in injury or death.

2. Install the Headset following the manufacturer's instructions. Make sure there should be no play in the headset, but the bearings should not feel rough or bind.
3. Ensure handlebar is aligned straight and install Stem top cap ② tighten the Fixing Bolt ③ to torque of 41 kgf.cm / 4 Nm / 35 in.lbs. until proper bearing preload is achieved.

NOTICE Proper bearing preload is apparent when there is no " knock " (fore / aft or up / down free play) in the headset assembly, while the bearings rotate freely (free steering motion.).

4. Gradually tighten the Stem Fixing Bolts ⑩ by alternating turning each screws 1/4 to 1/2 turn at a time so both screws tighten simultaneously to 51-61 kgf.cm / 5-6 Nm / 44-53 in.lbs. DO NOT exceed maximum torque specification. Always use a calibrated torque wrench.

Light / GoPro Mount Installation

1. Install Computer mount adaptor ⑪ to Handlebar body ① for the desired position by adding Spacer ⑥, ⑦. and follow **Cable Installation** 2、3、4 to install Handlebar body.
2. Install GoPro Adapter ⑫ if GoPro Mount needed. Insert Fixing Bolt ⑬ through Computer mount adaptor ⑪ to tighten with the GoPro Adapter ⑫ to torque 20 kgf.cm / 2 Nm / 18 in.lbs.

Control Center Installation

1. Install Control Center Base ④ onto Stem Top Cap ② or Computer mount adaptor ⑪ , tighten the Control Center Base Screws ⑤ to torque 20 kgf.cm / 2 Nm / 18 in.lbs.

Contact

If you have questions, please visit our web site technical section: https://www.fullspeedahead.com/en/support or contact:

FULL SPEED AHEAD EUROPE
VIA DEL LAVORO, 56
20874 BUSNAGO, (MB), ITALY
PH. +39 039 688 52 65

FULL SPEED AHEAD USA
12212 CYRUS WAY
MUKILTEO, WA 98275-5702
PH. +1 425 488 8653

FULL SPEED AHEAD ASIA
NO.6, WUGONG 8TH RD., WUFENG DIST.,
TAICHUNG CITY 41353
PH. +886 4 2331 9134

FULL SPEED AHEAD CHINA
ROOM A405, BUILDING 2, NO.88, BAIFU ROAD.,
KUNSHAN DEVELOPMENT ZONE
PH. +86 512 5702 2458

Notes: Specifications of product may be changed or improved for performance. Please refer to website periodically for technical updates and revised instructions.